


REAR LAMPS

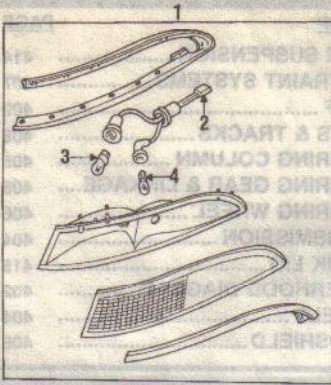


PARTS AND R&R OPERATIONS

TAIL LAMPS

1993-96

492	1 Tail lamp assy	93-96 R	148.04	0.6	F3LY 13404 A
493		93-96 L	148.07	0.6	F3LY 13405 A
494	2 Socket	93-96	13.32		F3LY 13410 A
	Bulb				
495	3 brake/signal lamp	93-96	2.22		F5DZ 13466 C
496	4 marker lamp	93-96	2.19		E3MY 13466 A

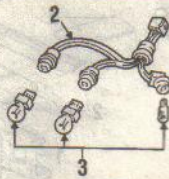


PARTS AND R&R OPERATIONS

TAIL LAMPS

1997-98

2174	1 Tail lamp assy	97-98 R	159.80	0.6	F7LY 13404 AB
2175		97-98 L	159.80	0.6	F7LY 13405 AB
2176	LSC	97-98 R	166.46 #	0.6	F7LY 13404 AAD
2177		97-98 L	166.46 #	0.6	F7LY 13405 AAD
2179	2 Socket	97-98 B	14.38		F7LZ 13410 AA
	Bulb				
2180	3 brake/signal lamp	97-98	2.22		F5DZ 13466 C
2181	marker lamp	97-98	2.19		E3MY 13466 A
2183	back-up lamp	97-98			F5DZ 13466 D

PARTS: Order by color.

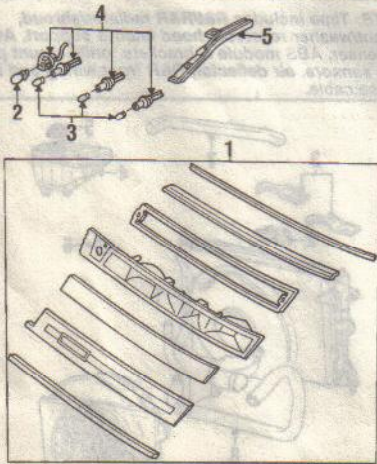


REAR REFLECTOR

1993-96

513	1 Reflector panel	93-96	384.68	0.6	F3LY 13A565 A
	Bulb				
514	2 back-up lamp	93-98	3.13		F5DZ 13466 B
515	3 reflector	93-96	.88		C7SZ 13466 B
516	4 Wire harness	93-96	50.43		F3LY 14A227 B

2170	5 Trough	93-96 R	4.40		F3LY 6345120 C
2171		93-96 L	4.40		F3LY 6345121 C

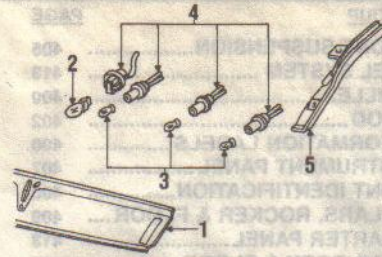

REAR REFLECTOR


1997-98

1458	1 Reflector panel				
	base	97-98	739.43	0.6	F7LY 13A565 BA
2192	LSC	97-98	677.05 #	0.6	F7LY 13A565 AAD
	Bulb				
2184	2 back-up lamp	97-98	3.13		F5DZ 13466 B
2193	3 reflector	97-98	.88		C7SZ 13466 B
2187	4 Wire harness	97-98	23.33		F7LZ 14A227 AA
2190	5 Trough	97-98 R	8.14		F7LZ 6345120 AA
2191		97-98 L	8.65		F7LZ 6345121 AA
	Nameplate				
2159	LSC	97-98	9.99	0.2	F8LZ 6342528 AA
2158	LINCOLN	97-98	9.99	0.2	F8LZ 6342528 BA
2160	MARK VIII	97-98	9.99	0.2	F8LZ 6342528 CA
2161	32V INTECH V8	97-98	9.99	0.2	F8LZ 6342528 DA
2162	LINCOLN STAR	97-98	9.99	0.2	F8LZ 6342528 EA

LICENSE LAMPS

593	License lamp	93-98	20.52	0.3	F3LY 13550 B
594	Bulb	93-98	.88	0.2	C7SZ 13466 B


PARTS: Order by color.

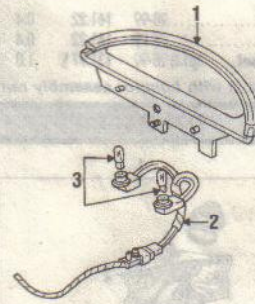

HIGH MOUNTED STOP LAMP

535	1 High mount lamp	93	72.72	0.5	F3LY 13A613 A
875		94-98	90.31	0.5	F4LY 13A613 A
536	2 Socket & wire	93	37.52		F3LY 13A625 A
1114		94-96	18.55		F4LZ 13A625 AB
1460		97-98	13.15		F7LZ 13A625 AA
537	3 Bulb	93	2.62	0.2	E6DZ 13466 B
894		94-98	2.22	0.2	F5DZ 13466 C

REAR BUMPER

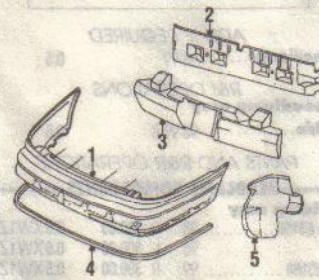

OVERHAUL OPERATIONS

688	O/H bumper assy	93-98	2.3		
-----	-----------------	-------	-----	--	--

R&I OPERATIONS

687	R&I rear bumper	93-98	1.0		
-----	-----------------	-------	-----	--	--

PARTS AND R&R OPERATIONS

589	1 Bumper cover	(p2.5) 93-94	659.87	2.3	F3LY 17K835 A
2194	w/ bright mid	(p2.5) 95-96	710.25	2.3	F5LY 17K835 AA
895	w/ bright mid	(p2.5) 95-96	693.27	2.3	F5LY 17K835 A
1461	all	(p2.5) 97-98	382.12	2.3	F7LZ 17K835 AA
830	hardware kit	93-98	30.71		F3LY 17C756 C
590	2 Impact bar	93-96	130.50 #	2.3	F3LY 17906 A
1462		97-98	113.05 #	2.3	F7LZ 17906 AA

591	3 Isolator	93-96	102.92 #	2.3	F3LY 17906 B
1463		97-98	75.58 #	2.3	F7LZ 17906 BA
592	4 Molding	93-96	59.23 #	0.5	F3LY 17C830 A
2195		97-98			NOT USED
826	5 Shield	93-96 R	17.72	0.2	F5LY 6328456 AAA
829		93-96 L	D10.38	0.2	F3LY 6328457 A
1464		97-98 R	11.92	0.2	F7LZ 6328456 AA
1465		97-98 L	10.48	0.2	F7LZ 6328457 AA

LABOR: Time is for overhaul.

† PARTS: Part is also included with bumper cover.

Please contact our Product Support Group if you require assistance locating, interpreting or using any information contained in this Estimating Guide. Toll Free Number: 1-800-426-6867.